

CARE AND MAINTENANCE INSTRUCTIONS - HOME ENVIRONMENTS

These are the care and maintenance instructions for flooring from Dala Floda Golv used in the home environment. We recommend that you use Osmo's products for care and maintenance. You will find Osmo's maintenance products with quality paint and construction specialist dealers. Follow these instructions and the hard wax surface remains sustainable, beautiful, and easy to care for!

General

You should have a good doormat in the hall to collect as much hard and wet dirt as possible. Always work sparingly with water since the wood surfaces can be damaged by this. If the main part of a surface is so strongly worn that treatment with Osmo 3029 Maintenance wax is not sufficient, then Periodical maintenance is required.

Regular cleaning

Surfaces treated with Osmo hard wax oil are easy to clean. Loose dirt should be vacuum-cleaned or removed with a dry mop regularly.

Moisture Drying (product image 1)

Moisture drying can be done easily with Osmo 8016 cleanser. Dosage: 1 capsule/approx. 10 ml product to 1 litre warm water. Use a damp mop. The surface should be dry after 1-2 minutes.

Refreshing (product images 2, 3)

Osmo 3029 Maintenance wax is used after moisture drying in order to, when needed, freshen up the hard wax-oiled surface. 2 teaspoons are enough for about 1 m², 0.5 litres to 35-50 m². The can is shaken and the cleanser is applied very thinly on the clean, dry surface with a micro-fibre mop or an Osmo Easy Pad lint-free cloth.

Removal of stubborn stains (product images 2, 3, 5)

Stubborn stains, for example, shoe scuffs, are easily removed with Osmo 3029 Maintenance wax. The can is to be shaken and the cleanser is placed on a white scrub pad or Osmo Easy Pad lint-free cloth. Rub the area where the stain is and the dissolved dirt can be wiped away. For easier cleaning and maintenance, Osmo 3029 Maintenance wax also comes in a spray.

Point Renovation - damages/scratches (product images 2, 3, 5, 7)

If the surface has minor damages/scratches, it is usually sufficient to clean the surface and apply a new layer of hard wax oil.

If that is not sufficient, do the following:

- a. Sand away the damage/scratches with finer sandpaper with a grain of 150.
- b. Re-treat the sanded surface with Osmo hard wax oil or pigmented Osmo products of the type used in basic treatment. Apply a thin layer with a white scrub pad, Osmo Brush or an Osmo Easy Pad lint-free cloth.
- c. Let dry for around 12 hours or approximately 24 hours (pigmented products).
- d. If the surface appears to be dry or if it has pigmentation, apply a thin layer of hard wax oil in accordance with b-c.
- e. If required, use Osmo 3029 Maintenance wax to refresh the entire surface.

Maintenance (product images 1, 2, 3, 4, 6, 8)

Maintenance should be carried out once a year, or more often if the surface is heavily soiled, dull or worn.

- a. Loose dirt should be vacuum-cleaned or removed with a dry mop.
- b. Clean the surface thoroughly by hand with a red Doodlebug or with an Osmo Floor Machine and red pad. Use Osmo 8016 Cleaner mixed with water with a maximum dose of 1:1, depending on the degree of soiling. Work sparingly with water.
- c. Allow the surface to dry for at least 30 minutes before beginning further work. The surface must be completely dry.
- d. Shake thoroughly and click or spray Osmo 3029 Maintenance wax over a smaller area.
- e. Apply the product in a thin layer and work it into the surface by hand with a white Doodlebug or an Osmo Floor machine with a white pad.
- f. Wipe/smooth out any excess using an Osmo Easy Pad lint-free cloth.
- g. When the surface has dried for around 1 hour, it is ready to use.
- h. If a higher gloss surface is desired, the surface can be polished. Polishing to the desired gloss is done by hand with a white Doodlebug or using the Osmo Floor Machine and a white pad.

Periodic maintenance (product images 2, 3, 4, 6, 9, 10, 11)

It is important that the surface is totally clean before applying new hard wax oil, since the remnants of Osmo 3029 Maintenance wax can give a milky appearance. Therefore, always start periodic maintenance by carrying out the instructions under points a-c under maintenance as stated above.

If the damaged surface has pigmentation, the damage must be point-renovated before finishing.

a. Apply a very thin layer Osmo hard wax oil (the same type used in the basic treatment with Osmo brush or

Osmo Micro-fibre roller) or apply a very thin layer of Osmo double putty and level the surface with an Osmo floor machine and white pad. Possible splashes and excess at the edges and corners that are not picked up by the pad should be wiped away with an Osmo Easy Pad lint-free cloth.

b. Let dry for around 12 hours (3062/3065/3032/3011) or 4–6 hours (3262/3232) before using the surface. For white-waxed surfaces, Osmo maintenance wax 3087 is used instead of 3029.

Product images



1
Osmo 8016 Cleanser




2
Osmo 3029/3087
Maintenance wax



3
Osmo Easy Pad



4
Osmo Floor Machine

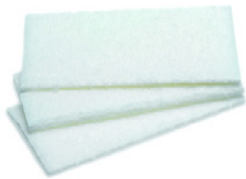

5
White scrub pad



6
Pads




7
Osmo Brush



8
Red/white Doodlebug



9
Osmo Brush

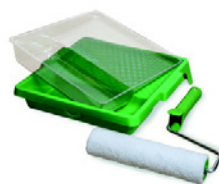

10
Micro-fibre roller



11
Osmo Double putty